Top Track

"B" Mark


Cut Line


STERLING




IMPORTANT! Do not cut the top track the same

length as the bottom track. Walls must be within 3/8" (10 mm) of plumb. Cover drain with tape to avoid loss of small parts. Follow the silicone sealant manufacturer's instructions for application and curing time. Installation video available at SterlingPlumbing.com.

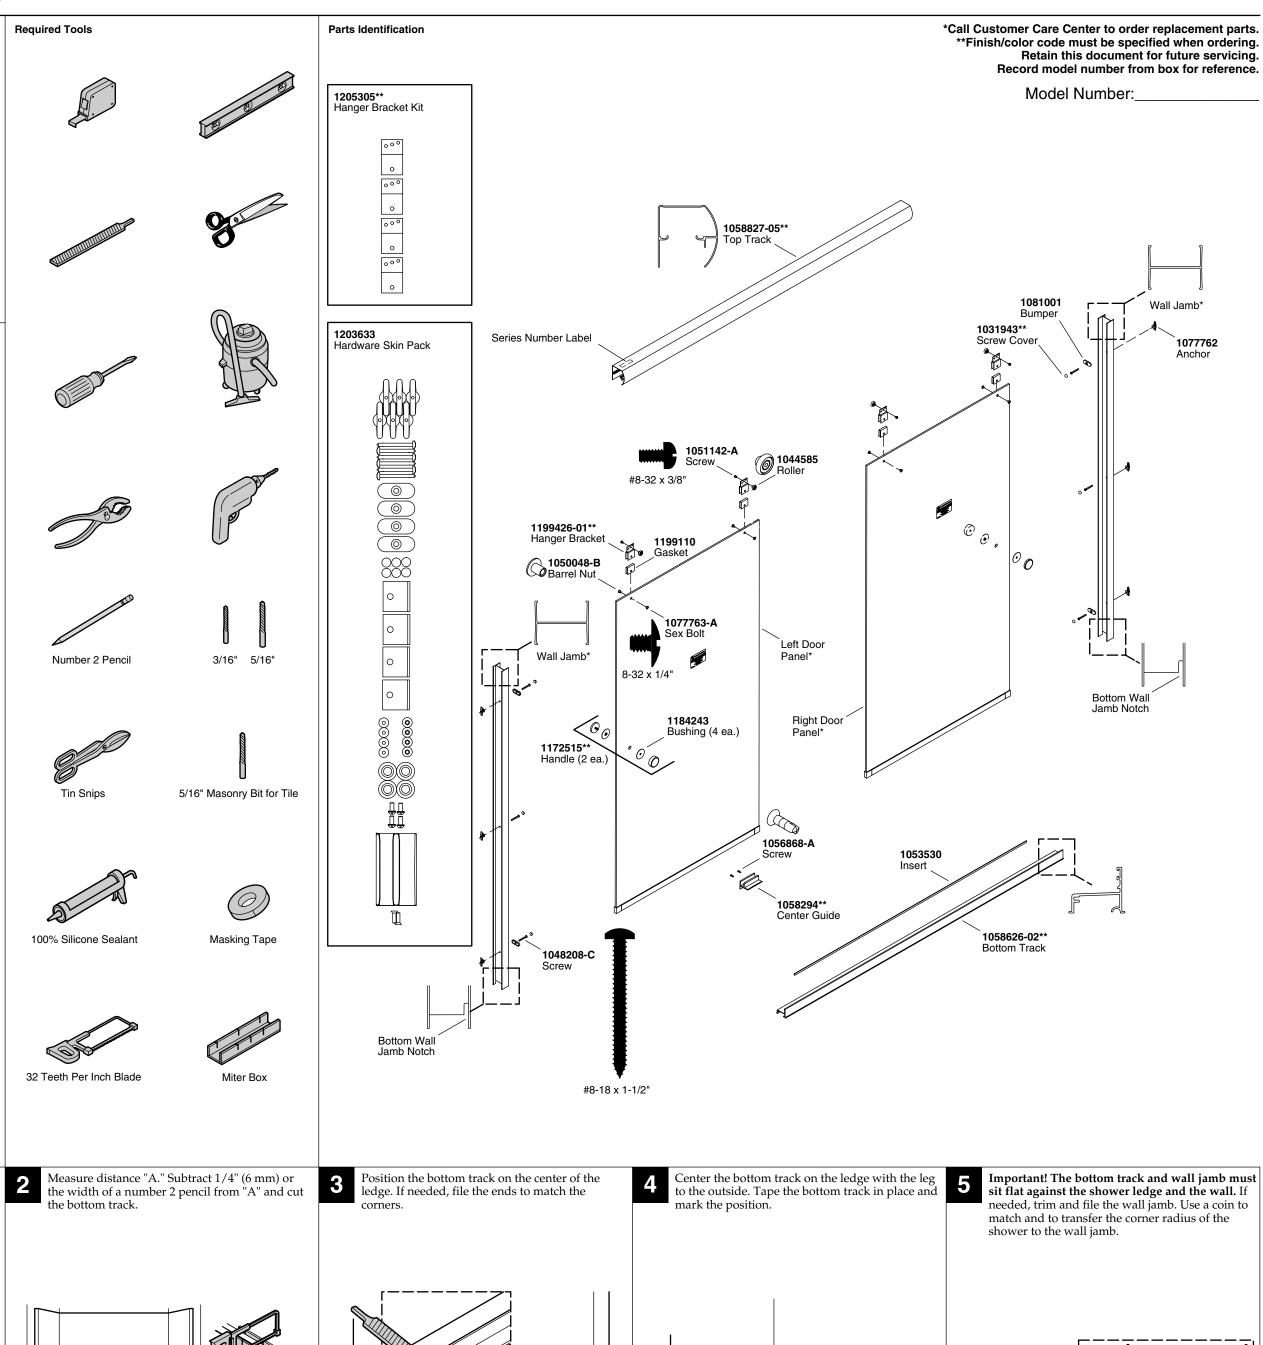

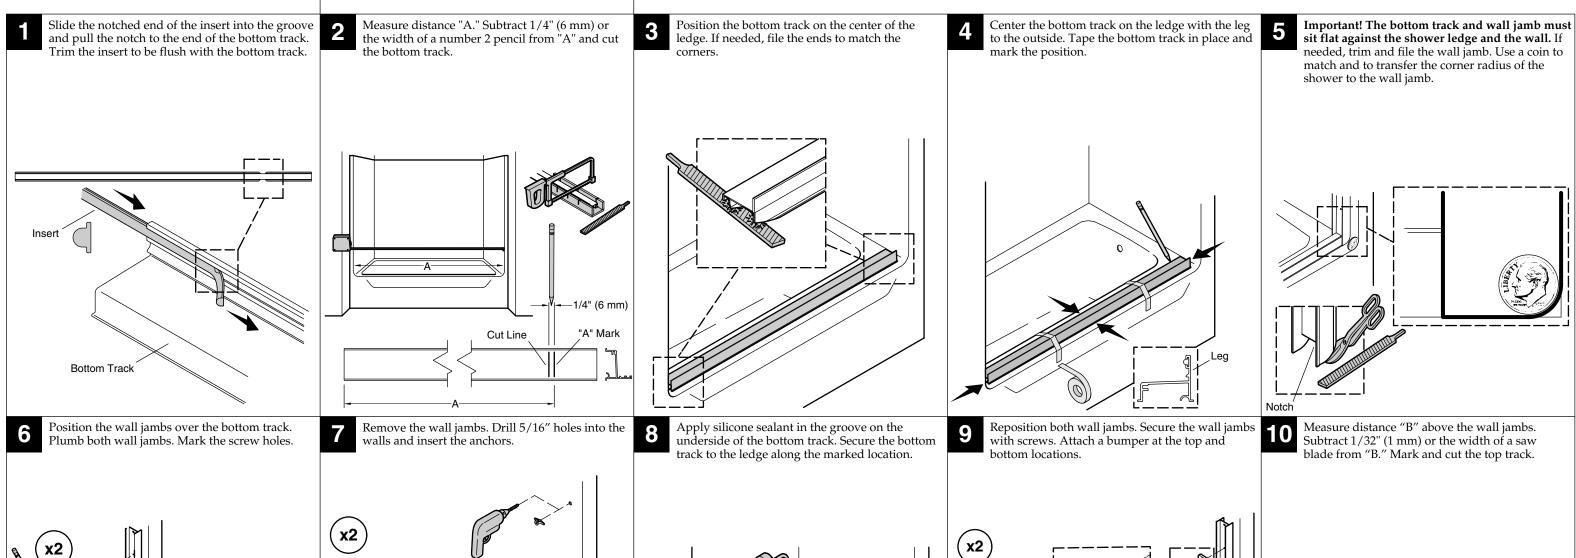

1204888-2-**A**

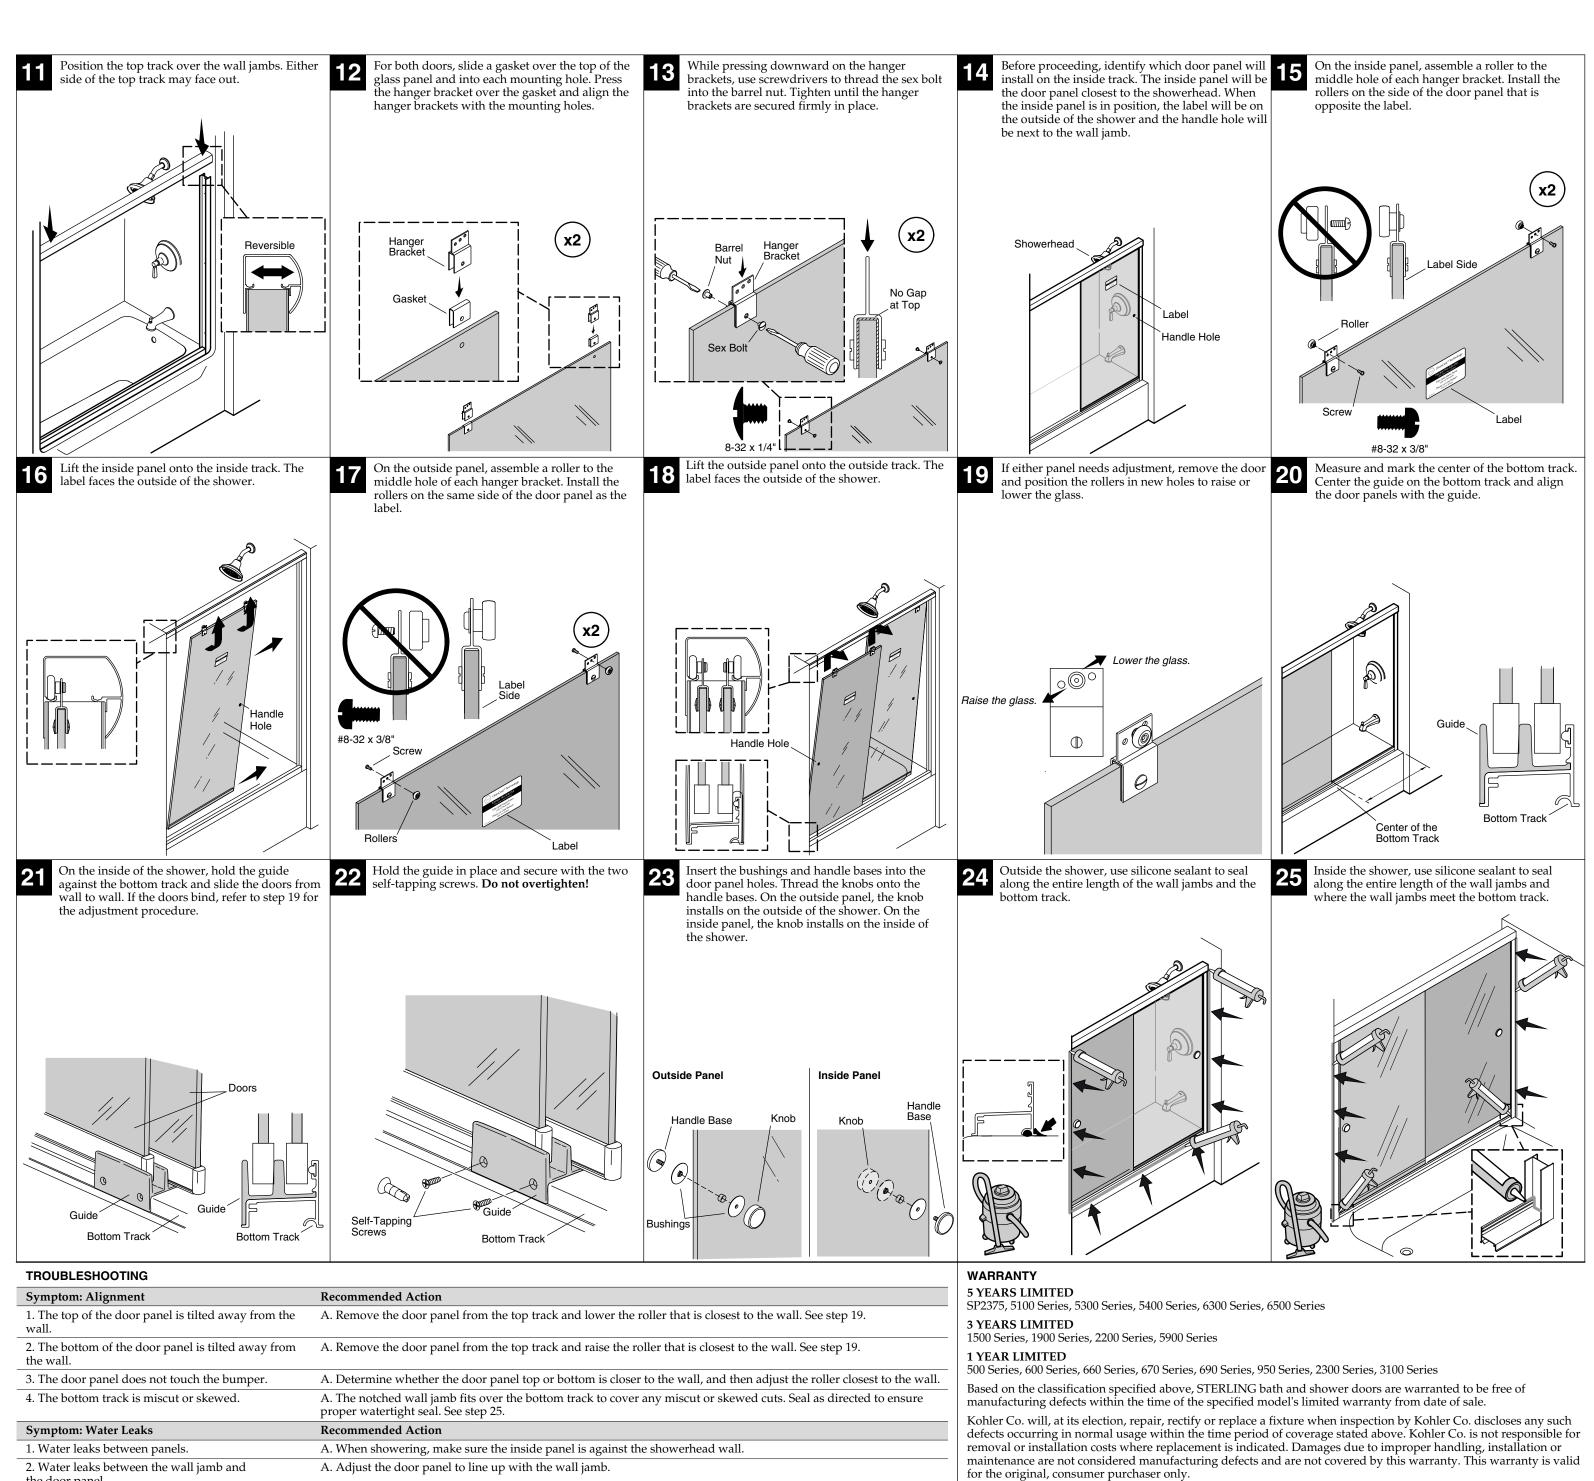

TROUBLESHOOTING	
Symptom: Alignment	Recommended Action
1. The top of the door panel is tilted away from the wall.	A. Remove the door panel from the top track and lower the roller that is closest to the wall. See step 19.
2. The bottom of the door panel is tilted away from the wall.	A. Remove the door panel from the top track and raise the roller that is closest to the wall. See step 19.
3. The door panel does not touch the bumper.	A. Determine whether the door panel top or bottom is closer to the wall, and then adjust the roller closest to the wall.
4. The bottom track is miscut or skewed.	A. The notched wall jamb fits over the bottom track to cover any miscut or skewed cuts. Seal as directed to ensure proper watertight seal. See step 25.
Symptom: Water Leaks	Recommended Action
1. Water leaks between panels.	A. When showering, make sure the inside panel is against the showerhead wall.
2. Water leaks between the wall jamb and the door panel.	A. Adjust the door panel to line up with the wall jamb.
3. Water leaks under the bottom track.	A. Check for proper silicone sealant application. See steps 24 and 25. Apply more silicone sealant in the leak location.
Symptom: Operation (open/close)	Recommended Action
1. The outside panel is difficult to move.	A. Ensure a gap exists between the bottom track and the door panel. If no gap exists, lower the rollers to the next hole
	B. Ensure the inside center guide is properly secured with the self-tapping screws. See step 22.
	C. Ensure the rollers are properly installed. See steps 17 and 18.
	D. Clean any debris in the top track groove.
2. The inside panel is difficult to move.	A. Ensure a gap exists between the bottom track and the door panel. If no gap exists, lower the rollers to the next hole

C. Ensure the rollers are properly installed. See steps 15 and 16.

D. Clean any debris in the top track groove.

B. Ensure the inside center guide is properly secured with the self-tapping screws. See step 22.

obtain warranty service, contact Sterling, either through your plumbing contractor, home center, wholesaler or caler, or by calling or writing Sterling, Consumer Services, 444 Highland Drive, Kohler, Wisconsin 53044,

O THE EXTENT PERMITTED BY LAW, ALL IMPLIED WARRANTIES INCLUDING THOSE OF ERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE ARE HEREBY DISCLAIMED. OHLER CO. AND SELLER HEREBY DISCLAIM ANY LIABILITY FOR SPECIAL, INCIDENTAL, OR ONSEQUENTIAL DAMAGES. Some states/provinces do not allow limitations on how long an implied warranty sts, or the exclusion or limitation of special, incidental or consequential damages, so these limitations and clusions may not apply to you. This warranty gives you specific legal rights. You may have other rights which vary from state/province to state/province.

This is the exclusive written warranty for Kohler Co.